

! ATTENTION INSTALLER !

The following list describes errors/inconsistencies found in the Avital Model 5303L Installation Guide N5303L 2008-07:

Installation Guide

Page	Description/error	Correction																		
inside cover	Error is found in the Bitwriter® chip version requirement: version 2.5	The Bitwriter (p/n 998U) requires chip version 2.6 or newer to program this unit.																		
41	Error is found in Menu 1 - Basic, 14: One-chirp setting - Comfort Closure ON Two-chirp setting Comfort Closure OFF (3) Comfort Closure (2)	One-chirp setting - Comfort Closure 1 ON Two-chirp setting Comfort Closure OFF (2), Comfort Closure (3) (* indicates the number of LED flashes.																		
42	Error is found in Menu 2 - Advanced, # 9:	The One-chirp setting Factory disarm with trunk release , is programmed ON, the default. Two-chirp setting is programmed OFF.																		
42	Errors are found in Menu 2 - Advanced, #12 -17:	<table border="1" style="width: 100%; border-collapse: collapse;"> <tbody> <tr> <td style="width: 5%; text-align: center;">12</td> <td style="width: 60%;">Aux 1 validity (1)</td> <td style="width: 35%;">Latched (2), Latch reset with ignition (3), 30-secs timed (4), 60-secs (5), 90-secs (6)</td> </tr> <tr> <td style="text-align: center;">13</td> <td>Aux 1 Linking None (1)</td> <td>Arm (2), Disarm (3), Remote Start (4)</td> </tr> <tr> <td style="text-align: center;">14</td> <td>Aux 2 validity (1)</td> <td>Latched (2), Latch reset with ignition (3), 30-sec. timed (4)</td> </tr> <tr> <td style="text-align: center;">15</td> <td>Aux 2 linking None (1)</td> <td>Arm (2), Disarm (3), Remote Start (4)</td> </tr> <tr> <td style="text-align: center;">16</td> <td>Aux 3 validity (1)</td> <td>Latched (2), Latch reset with ignition (3), 30-sec. timed (4)</td> </tr> <tr> <td style="text-align: center;">17</td> <td>Aux 3 linking None (1)</td> <td>Arm (2).Disarm (3), Remote Start (4)</td> </tr> </tbody> </table>	12	Aux 1 validity (1)	Latched (2), Latch reset with ignition (3), 30-secs timed (4), 60-secs (5), 90-secs (6)	13	Aux 1 Linking None (1)	Arm (2), Disarm (3), Remote Start (4)	14	Aux 2 validity (1)	Latched (2), Latch reset with ignition (3), 30-sec. timed (4)	15	Aux 2 linking None (1)	Arm (2), Disarm (3), Remote Start (4)	16	Aux 3 validity (1)	Latched (2), Latch reset with ignition (3), 30-sec. timed (4)	17	Aux 3 linking None (1)	Arm (2).Disarm (3), Remote Start (4)
12	Aux 1 validity (1)	Latched (2), Latch reset with ignition (3), 30-secs timed (4), 60-secs (5), 90-secs (6)																		
13	Aux 1 Linking None (1)	Arm (2), Disarm (3), Remote Start (4)																		
14	Aux 2 validity (1)	Latched (2), Latch reset with ignition (3), 30-sec. timed (4)																		
15	Aux 2 linking None (1)	Arm (2), Disarm (3), Remote Start (4)																		
16	Aux 3 validity (1)	Latched (2), Latch reset with ignition (3), 30-sec. timed (4)																		
17	Aux 3 linking None (1)	Arm (2).Disarm (3), Remote Start (4)																		
43	Error is found in Menu 3 - Remote start, #3:	One-chirp setting, Parking light output: Constant Two-chirp setting, Flashing.																		
49	Error is found in Menu 2 Advanced Features descriptions. 2-12 2-14 2-16	2-12 - AUX 1 VALIDITY/LATCHED/LATCHED RESET WITH IGNITION/30, 60 and 90 SEC TIMED OUTPUT 2-14 - AUX 2 VALIDITY/LATCHED/LATCHED RESET WITH IGNITION/30,60 and 90 SEC TIMED OUTPUT 2-16 - AUX 3 VALIDITY/LATCHED/LATCHED RESET WITH IGNITION/30, 60 and 90 SEC TIMED OUTPUT																		
51	Error is found in Menu 3 - Remote start Feature description: 3-10 DIESEL TIMER - WAIT-TO-START	3-10 DIESEL TIMER - WAIT-TO-START (default)																		